

**CIRCULAR LETTER
NUMBER 04-2007**


ROTAX
NEW AGE KARTING



NEW SUPPORT BRACKET 251720

Dear distributor,

We would like to inform you about technical problem with new designed support bracket 251720.

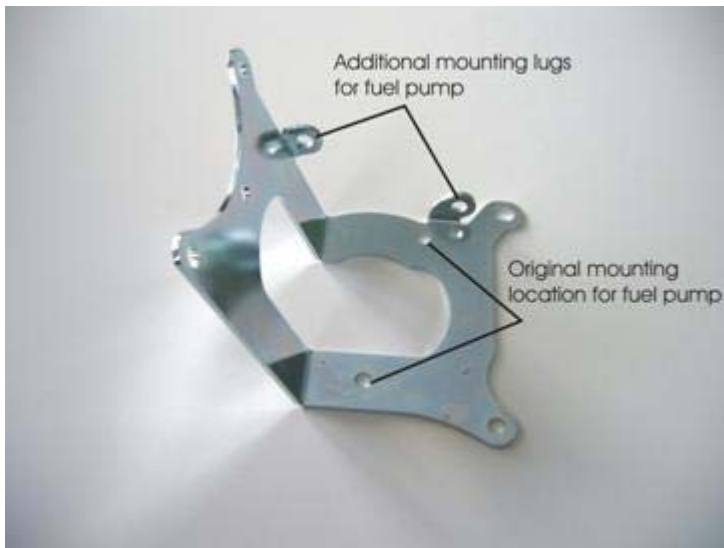

The problem is that if the fuel pump is mounted on the additional mounting lugs (see picture above) on the side of the support bracket, that this could lead "due to vibration" to a crack of the support bracket in the area at the head of the first mounting lug.

Please inform your service centres and customers not to install the fuel pump on the side of the support bracket.

For the future the additional mounting lugs shall be removed from the support bracket and should be available in approximately 2 months.

Best regards,

BRP-ROTAX